


ROZMĚROVÉ OBVODY

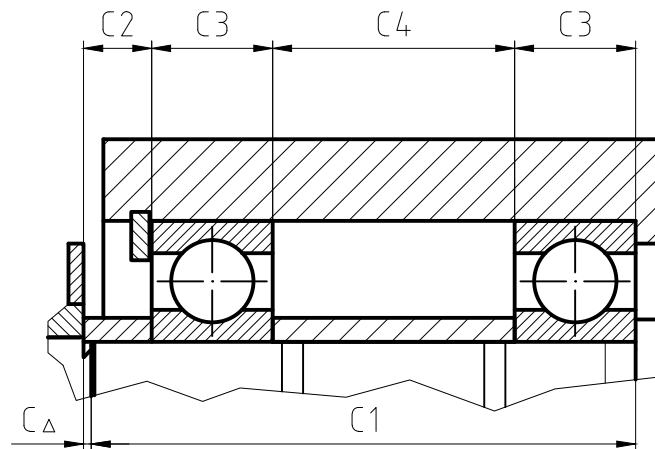

OSAZENÍ HŘÍDELE

$C1 = 36 \pm 0,1$	$T_{C1} = 0,2$
$C2 = 4,5 \pm 0,05$	$T_{C2} = 0,1$
$C3 = 8^{0}_{-0,06}$	$T_{C3} = 0,06$
$C4 = 16 \pm 0,2$	$T_{C4} = 0,4$
$C_{\Delta} = ?$	
$T_{C_{\Delta}} = T_{C1} + T_{C2} + T_{C3} + T_{C4} + T_{C3}$	
$T_{C_{\Delta}} = 0,2 + 0,1 + 0,06 + 0,4 + 0,06 = 0,82$	
$C_{\Delta\max} = C_{2\max} + C_{3\max} + C_{4\max} + C_{3\max} - C_{1\min}$	
$C_{\Delta\max} = 4,55 + 8 + 8 + 16,2 - 35,9 = 0,85\text{mm}$	
$C_{\Delta\min} = C_{2\min} + C_{3\min} + C_{3\min} + C_{4\min} - C_{1\max}$	
$C_{\Delta\min} = 4,45 + 7,94 + 7,94 + 15,8 - 36,1 = 0,03\text{mm}$	
$C_{\Delta} = 0,44$	
$T_{C_{\Delta}} = 0,82$	
$C_{\Delta} = 0,44 \pm 0,41$	