


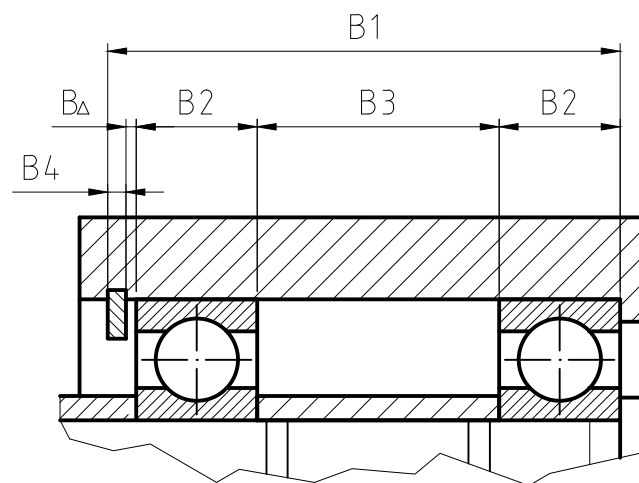

POJISTNÝ KROUŽEK

$B2 = 8^{0}_{-0,06}$	$T_{B2} = 0,06$
$B\Delta = 0,6 \pm 0,3$	$T_{B\Delta} = 0,6$
$B3 = 16 \pm 0,2$	$T_{B3} = 0,4$
$B4 = 1,3 - 0,06$	$T_{B4} = 0,06$
$B1 = ?$	

$$T_{B\Delta} = T_{B1} + T_{B2} + T_{B3} + T_{B4} + T_{B2}$$
$$T_{B1} = T_{B\Delta} - T_{B2} - T_{B3} - T_{B4} - T_{B2}$$
$$T_{B1} = 0,6 - 0,06 - 0,4 - 0,06 - 0,06 = 0,02 > 0 \rightarrow \text{OK}$$
$$B_{\Delta\max} = B_{1\max} - B_{2\min} - B_{2\min} - B_{3\min} - B_{4\min}$$
$$B_{1\max} = B_{\Delta\max} + B_{2\min} + B_{2\min} + B_{3\min} + B_{4\min}$$
$$B_{1\max} = 0,9 + 7,94 + 7,94 + 15,8 + 1,24 = 33,82\text{mm}$$
$$B_{1\min} = 0,3 + 8 + 8 + 16,2 + 1,3 = 33,8\text{mm}$$
$$T_{B1} = 0,02$$
$$B_1 = 33,8^{+0,02}_0$$